

Contractor	All Sealants, Inc.	Surveyed by	Jeff Schoettle
Date	8/22/2023 11:27 AM	Foremen	Steve Collaro
Project	Six Corners		4800 W Irving Park Rd Chicago,IL
Site Conditions			
Site Activity	Priming/ coating		
Notes			

#### **Comments on Project Conditions**

#### **Description of Condition**

Conditions are hot; water is available on the roof; discussed regular water intake and resting in a shaded area

Compressed gas cylinders are secured to prevent displacement

Safety can for flammable liquids is equipped with a flame arrestor

#### Recommendations

#### **Description and Recommended Action**

Smoking is not permitted where flammables are used

Fire extinguisher inspection should be conducted annually. Inspection tags missing from all 3 fire extinguishers on site

#### **Weather Conditions**


Clouds - scattered clouds; Wind from 100 @12.66mph; Temp: 83.39(f); Low: 77.97 - High: 89.73; Humidity: 68%

Documentation of work conditions and recommendations are based on information available at the time of this inspection report completion. This report does not imply or guarantee full compliance with local, state or federal regulations which may be applicable to such work practices and conditions. This report does not signify or imply that other hazards do not exist at this work location.

5/w

Six Corners 8/22/2023 11:27 AM

Conditions are hot; water is available on the roof; discussed regular water intake and resting in a shaded area

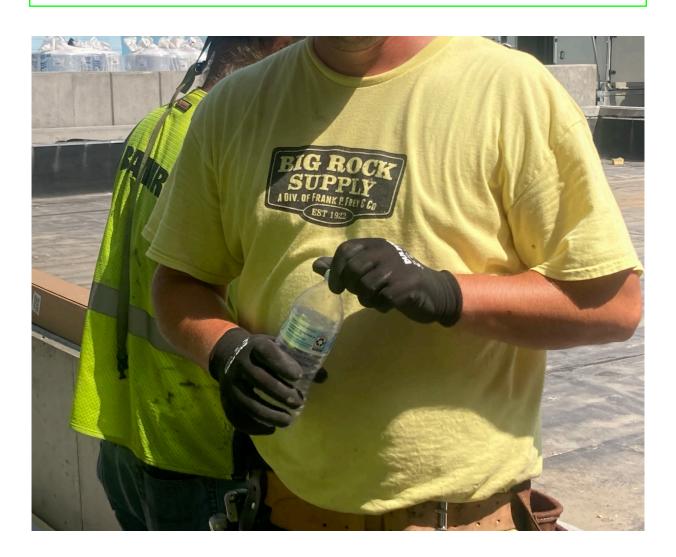

Six Corners 8/22/2023 11:27 AM

Compressed gas cylinders are secured to prevent displacement



Six Corners 8/22/2023 11:27 AM

Safety can for flammable liquids is equipped with a flame arrestor



Six Corners 8/22/2023 11:27 AM



Six Corners 8/22/2023 11:27 AM



Six Corners 8/22/2023 11:27 AM



Six Corners 8/22/2023 11:27 AM



Six Corners 8/22/2023 11:27 AM



Six Corners 8/22/2023 11:27 AM

Fire extinguisher inspection should be conducted annually. Inspection tags missing from all 3 fire extinguishers on site



Six Corners 8/22/2023 11:27 AM

Fire extinguisher inspection should be conducted annually. Inspection tags missing from all 3 fire extinguishers on site

